

# V-STARS S8 Demonstration Measurement Report



April 2006

# **Table of Contents**

Object Measured	3
Equipment Used	3
Measurement Objectives	
Targeting	
Photography	
Processing	
Measurement Statistics	
Numbering Guide	9
Point Cloud	
Analysis	11
PRO-SPOT Point Cloud Measurement	
Time Summary	13
Concluding Remarks	

## **Object Measured**

One object was measured as part of the V-STARS demonstration. The object was a small antenna lay up tool. A photo of the tool is shown on the cover of this report.

The primary objective of the object measurement was to determine the coordinates of points on the surface of the tool. These points would then be used to compute the best-fit parabolic surface for the antenna tool.

#### **Equipment Used**

- 1. V-STARS S8 INCA3 Camera
- 2. Scale Bars
- 3. AutoBar
- 4. Coded targets
- 5. Strip Tape



#### **Measurement Objectives**


- 1. Demonstrate INCA3 camera use
- 2. Determine location of key points on tool
- 3. Compute best-fit parabolic surface.


### **Targeting**

- 1. AutoBar for initial coordinate system
- 2. Reference coded targets to tie photography together
- 3. Two scale bars
- 4. Strip tape to measure surface

In order to meet the measurement objectives outlined earlier it was necessary to target the tool. In general, targets are placed on points or surfaces that are of interest. For surfaces, strips of retro-reflective tape of variable pitch and dot size are commonly used. They are relatively cheap, disposable and easy to apply. To coordinate tooling datums such as bushed holes or button datums, tooling targets are used. These come in a variety of shank and dot sizes. They are also available in variable orientations.

To automate the measurement process it was necessary to add "coded" targets to the jig. These targets are automatically detected and help the software determine the location and orientation of the camera at the time the photo was taken. They also help tie the entire object into a uniform coordinate system. The codes were placed on the front, back and sides of the jig.



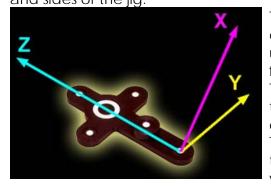


The initial coordinates system and scale is determined via the AutoBar. The AutoBar used by the V-STARS system is a fixture with five targets arranged in the form of a cross. The target's known coordinates are used by the AutoMatch procedure to determine the camera's orientation relative to the AutoBar. The AutoBar is securely attached on or near the measured object, preferably in a highly visible location. The AutoBar's default

coordinate system has its origin at Target 1 at the bottom of the AutoBar. The positive Z-axis goes through Target 3 at the top of the bar. The positive X-axis is up out of the AutoBar. The diagram on the left shows both the AutoBar and its coordinate system

To scale a photogrammetric measurement, there must be at least one known distance. Normally this distance comes from a calibrated coded graphite scale bar or invar scale bar (Refer to adjacent image). Typically multiple scales are used for redundancy. Two scale bars were used to complete this measurement.




Some of the key targeting features of the measurement are shown in the image below:

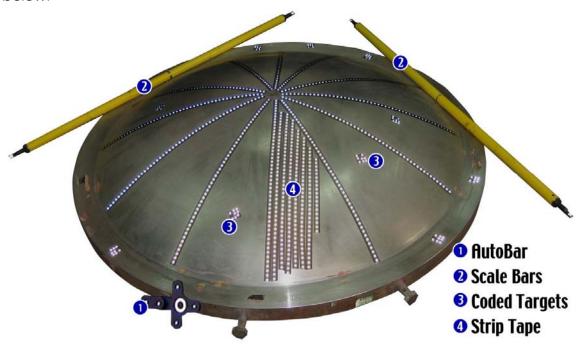

## Photography

The photography is carried out once the object targeting is completed. Put simply, the aim of the photography is to record each of the targeted points in as many images as possible from as wide a range of angles as possible. To improve the accuracy of the measurement, generally photos are taken both close to the ground and from an elevated position. The number of photos taken depends on the complexity of the measurement and accuracy requirements.

The diagrams below illustrate the geometry used to create the point cloud for the area.

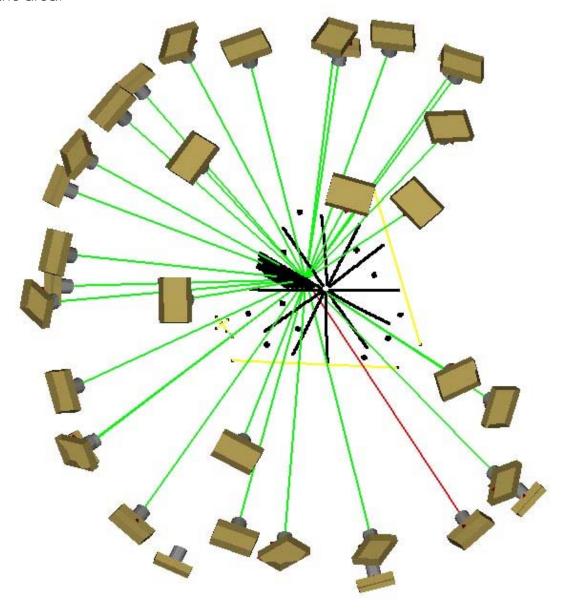


Network - Top View

#### **Processing**

Once the photography has been completed the images are transferred to the system laptop. The images are stored on a PCMCIA hard drive and V-STARS accesses these images directly from the drive.


Almost all of the measurement process is automated. The images are processed and the coordinates extracted by the "AutoMeasure" command. A typical AutoMeasure dialog box is shown on the right. The AutoMeasure command will of open each the images, determine the camera location. find new target points and finally adjust all the measurements in the "Bundle Adjustment".

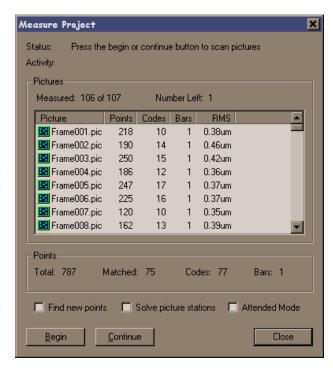

At the conclusion the user is left with the XYZ coordinates for all the target points in the network. The AutoMeasure procedure is very powerful as it allows the user to continue working while it processes the data. It also means that relatively unskilled workers can be used to process the data.

The AutoMeasure routine will assign random labels to the points it finds. These labels start with the key word "Target" followed by a number. If specific labeling is required the random labels can be easily changed to labels defined by the user. This is possible in both the picture view and the graphical 3D view. For this particular project the rows of points were re-labeled to make it easier to identify particular areas of the antenna.

Seen below is an image taken as part of the measurement.

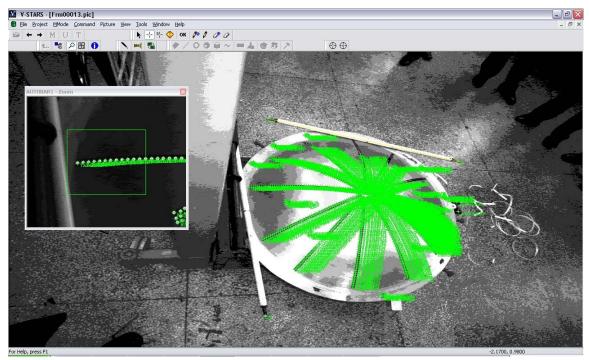


The green crosses represent points that have been located in this particular image. Note that the image appears a little dark and difficult to see. This is intentional as the best photogrammetric measurements are made on images that have dark backgrounds and bright targets. Some of these targets are shown in the zoom window in the corner. If the scale bar is visible then a yellow line will be drawn between the two end points.

#### **Measurement Statistics**


No. of photos	34	
No. of points	929	
Accuracy RM	1S X,Y,Z	
X	0.005 <b>mm</b>	
Υ	0.003mm	
Z	0.003mm	
Scale Agreement = 0.013mm		

A typical point listing is shown below.

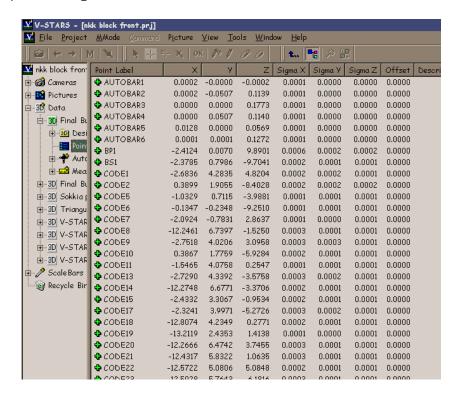

## **Numbering Guide**


The numbering scheme used is shown below.

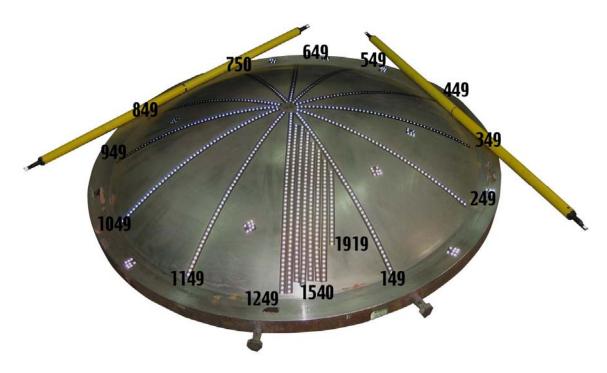

**Alignment**No alignment was necessary for this measurement.


## **Point Cloud**

The measurement produced the following point cloud.

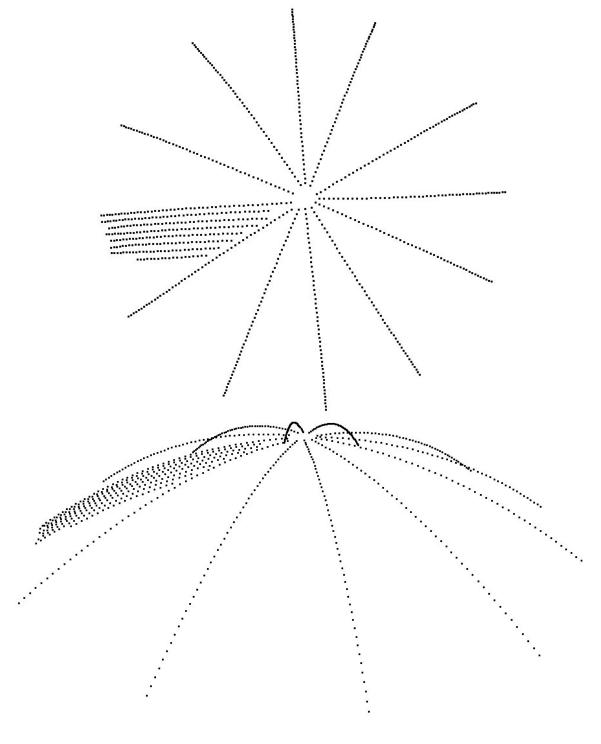


## **Analysis**


The point data collected was used to generate the best-fit parabolic surface. The results of the best-fit are shown below.

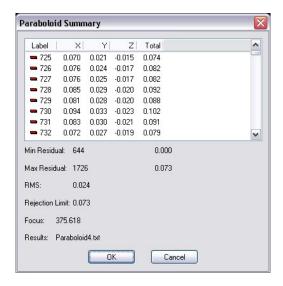

The focus of the parabolic surface is 375.618mm. The target thickness is 0.14mm and hence the corrected focus is 375.618 - 0.140 = 375.478mm.

The results of the best-fit are shown graphically below.

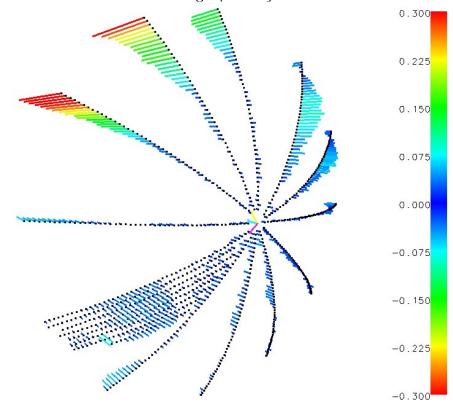

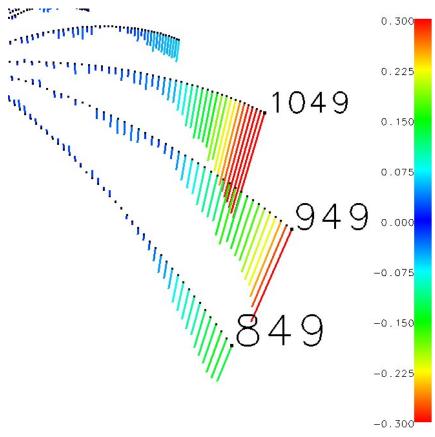


#### **PRO-SPOT Point Cloud Measurement**

The antenna was measured using strip tape. The alternate and preferred method would have been to use the PRO-SPOT target projection system. The PRO-SPOT is shown below.



The PRO-SPOT works by projecting targets onto the surface of the object being measured. The PRO-SPOT is capable of projecting up to 23,000 points onto the surface. This method is preferred as it removes the need to target the object as well as generating considerably more data.

A sample of targeting and the corresponding point cloud is shown in the image below.

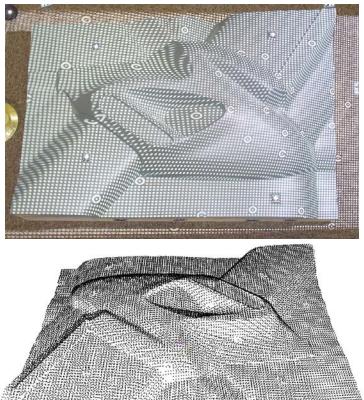

# **Time Summary**

Initial Investigation	1 minutes
Targeting	8 minutes
Photography	2 minutes
Processing	2 minutes
Analysis	2 minutes
Total	15 minutes

# **Concluding Remarks**

The measurement undertaken has shown that V-STARS can be a very powerful measurement tool. The results of the measurement undertaken were very accurate and produced quickly.